


Features and Benefits

- Magnetic technology offers robust performance.
- 100% Non-contacting design (no bearings or bushing) provides an extremely long life expectancy and is tolerant to harsh environments.
- Simple two piece design (target magnet + encoder) for easy alignment and installation.
- Bi-directional two channel incremental quadrature output. Option for differential RS422 compatible output.
- Mounting holes for a 2-bolt pattern 1.280 inch B.C. x 0.125 inch O.D.
- Target magnet for standard shaft sizes from 5/8 inch to 1 1/8 inch. Custom bore size available.
- Options for 512, 1024, and 2048 pulse per channel per revolution.
- Customizable lead wires, cables, and or connectors.



Kit - Encoder with Target Magnet
Shown with shaft pass through hole and single ended wiring
Wire color order varies with part configuration

Application Example

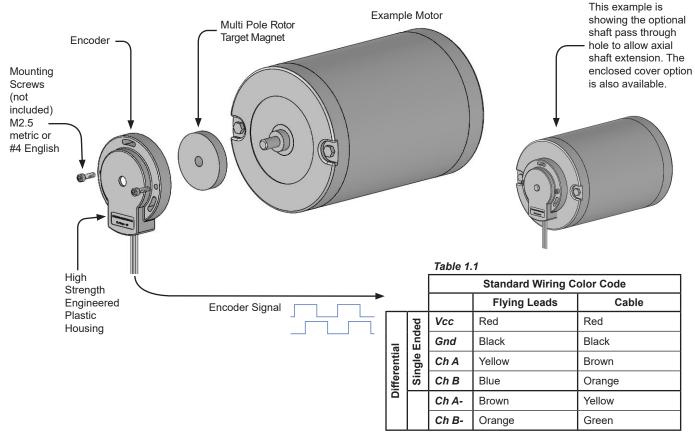


Other colors available upon request. Contact sales@phoenixamerica.com.

Tel: (888)-801-1422 Local: (260)-432-9664 Fax: (260)-432-9967 www.phoenixamerica.com sales@phoenixamerica.com © Copyright PAI 2017 Rev. 8/1/2017



Electrical Circuit

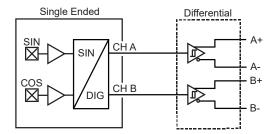

Absolute Maximum Ratings

Table 2.1

Characteristic	Symbol	Rating for 5V	Rating for 6V to 25V	Units
Forward Supply Voltage	V _{cc}	6	30	V
Reverse Supply Voltage	V _{RCC}	-0.3	-20	V
Storage Temperature	T _s	150	150	°C
ESD (HMB, 100pF/1.5Kohm)		2	2	kV

Specifications - 5V Supply

Table 2.2

Table 2.2						
Characteristic	Symbol	Test Conditions	Min.	Тур.	Max.	Unit
Supply Voltage	V _{cc}	Operating, T _J < 165 °C	4.75	5	5.5	V
Supply Current	I _{cc}	V _{cc} = 12V	-	14	20	mA
Operating Temperature	T _A		-40	-	125	°C
Duty Cycle	-		40	50	60	%
Phase	-		70	90	110	°e
Output Frequency	f _{out}		-	-	42	kHz

Specifications - 24V Supply

Table 2.3

Characteristic	Symbol	Test Conditions	Min.	Тур.	Max.	Unit
Supply Voltage	V _{cc}	Operating, T _J < 165 °C	5.25	12	24	V
Supply Current	I _{cc}	V _{cc} = 12V	-	-	-	mA
Operating Temperature	T _A		-40	-	125	°C
Duty Cycle	-		40	50	60	%
Phase	-		70	90	110	°e
Output Frequency	f _{out}		-	-	42	kHz




Output Waveforms Single Ended Pulse Count (PPR) 1022 1023 Key: C - Count P - Pulse CH A A Leads B Pulses φ - Phase CH B 1 PPR = 4 Counts 1 Pulse = 360°e Pulses Ċ3 Pulse (1024) 0 1022 1023 Count CHA Pulses B Leads A Pulses Differential Pulse Count (1024) 0 (PPR) 1022 1023 Key: C - Count CH A+ Pulses P - Pulse φ - Phase 1 PPR = 4 Counts 1 Pulse = 360°e CH A-Pulses CH B+ Pulses CH B-Pulses Pulse (1024)1022 1023 Count CH A+ Pulses CH A-Pulses CH B+ B Leads A Pulses CH B-Pulses Channel A leads Channel B for clockwise shaft rotation (shaft rotation is defined when looking at the branded face of the encoder). Page 3

Tel: (888)-801-1422 Local: (260)-432-9664 Fax: (260)-432-9967



Encoder Physical Outline

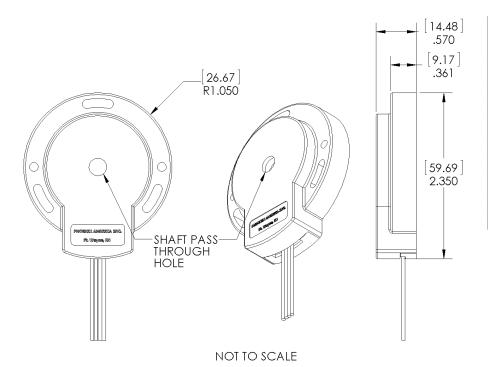

Tahlo 4 1


Motor Shaft Diameter	Shaft Pass Through Hole Size (options/ recommendation)			
-	No Hole			
5/8 in	15.91 mm	0.627 in		
19 mm	19.06 mm	0.751 in		
3/4 in	19.09 mm	0.752 in		
7/8 in	22.26 mm	0.877 in		
24 mm	24.06 mm	0.948 in		
1 in	25.43 mm	1.002 in		
28 mm	28.06 mm	1.106 in		
1 1/8 in	28.60 mm	1.127 in		

Other shaft pass through hole sizes available upon request. Contact sales@phoenixamerica.com.

Encoder Mounting Guidelines

Concentricity of the encoder housing to the magnet rotor is critical for optimal encoder performance. Considering the following during the design phase will ensure concentricity and ease of assembly.

- Tight molding tolerances allow for the outside diameter of the encoder to be used to locate the encoder housing concentric to the motor shaft and magnet rotor. A machined pocket on the motor endbell works well for alignment. Recommended pocket is 0.015" to 0.020" deep and 2.11" in diameter.
- Extending the shaft through the optional shaft pass through hole is an easy way to align the encoder housing to the motor shaft and magnet rotor. Simply position the encoder so that the shaft is centered concentrically in the shaft pass through hole.
- If previous two methods of alignment are not used it is recommended that the encoder be fastened to the motor using #5-40 or M3 mounting screws. The slightly larger diameter of the #5-40 and M3 screws will compensate for some of the tolerance allowed when using the standard recommended #4-40 or M2.5 mounting screws.

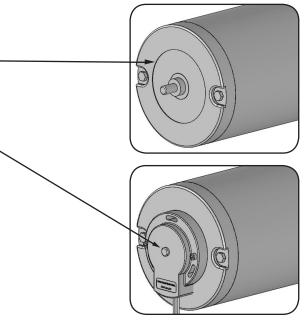

Page 4

Tel: (888)-801-1422 Local: (260)-432-9664 Fax: (260)-432-9967



Target Rotor Physical Outline - Molded (Mounting Style A)

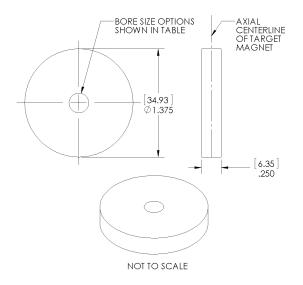


Table 5.1


Bore Size (.inch)	Motor Shaft OD Size (nominal)	NEMA Guide Shaft Tolerance	Magnet Bore MIN. (inch)	Magnet Bore MAX. (inch)
0625	5/8 in (.625")		.627	.629
0748	19 mm (.748")	+0.0000"/-0.0005"	.750	.757
0750	3/4 in (.750")		.757	.759
0875	7/8 in (.875")		.877	.879
0945	24 mm (.945")		.947	.949
1000	1 in (1.000")		1.002	1.004
1102	28 mm (1.102")		1.104	1.106
1125	1 1/8 in (1.125")		1.127	1.129

Other bore sizes available upon request. Contact sales@phoenixamerica.com.

Target Rotor Mounting Guidelines - Molded (Mounting Style A) For Slip Fit Application

- Proper alignment of the target rotor to the encoder sensing element is critical for optimal encoder performance. Insure that the rotor is mounted to the specified height shown in the diagram below.
- A machined step on the motor shaft provides a quick and repeatable method for positioning the target rotor. Spacers or other fixturing should be used to properly position the rotor if no mechanical locating features are on the shaft.
- Various adhesives can be used to bond the target rotor to the motor shaft. Shaft alloys, operating environment, and shaft speed and
 acceleration should be taken into consideration when selecting an appropriate bonding agent. Loctite threadlockers and retaining
 compounds have proved effective in bonding the target rotor to the motor shaft. Loctite 263 and 2760 threadlockers and Loctite 638 and
 680 retaining compounds are good candidates. These materials have been effective in past experience; testing under actual operating
 conditions should be used to qualify any bonding material.
- For best results, the motor shaft should be clean and free of any oils, lubricants, or solvents.
- Apply adhesive around the leading edge of the shaft and inside the hole in the rotor. Use a rotating motion when assembling the magnet
 to the shaft to insure good adhesive coverage.
- The use of primers and activators can be used to improve bond strength and cure rate.
- For non-critical applications or for fast bonding for evaluation, a cyanoacrylate adhesive (super glue) can be used. Loctite 401 and 410 have proven effective for quick bonding applications.



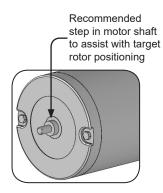


Page 5

Tel: (888)-801-1422 Local: (260)-432-9664 Fax: (260)-432-9967


Table 6.1



Wiring (Single ended option depicted)

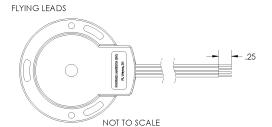

- 24 AWG
- 7x32 Strands, Tinned Copper
- **PVC** Insulation
- **UL Type 1430**
- Temperature Rating: 105°C

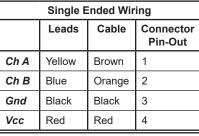



- 24 (or 26) AWG
- 4 (or 6) Conductor with Foil Shield and Drain
- Stranded Tinned Copper
- **PVC Insulation**
- Grev PVC Jacket
- UL Style 2464, CSA
- Temperature Rating: 105°C


Differential Wiring					
	Leads	Cable	Connector Pin-Out		
Ch B	Blue	Orange	1		
Ch B-	Orange	Green	2		
Ch A	Yellow	Brown	3		
Ch A-	Brown	Yellow	4		
Gnd	Black	Black	5		
Vcc	Red	Red	6		

Custom lengths and insulation materials available. Contact sales@phoenixamerica.com.

Connector Options (Single ended option depicted)

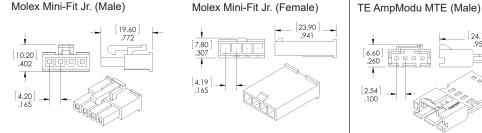


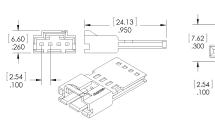

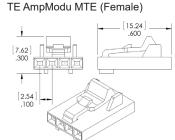

Need a different connector? Contact sales@phoenixamerica.com.

Part Number Description

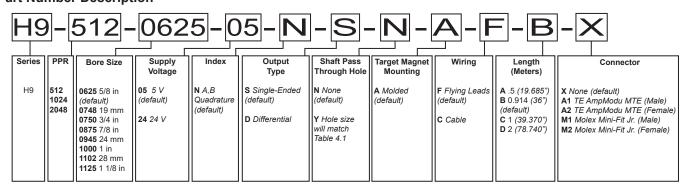

Example: H9-512-0625-05-N-S-N-A-F-B-X

Tel: (888)-801-1422 Local: (260)-432-9664 Fax: (260)-432-9967

www.phoenixamerica.com sales@phoenixamerica.com © Copyright PAI 2017 Rev. 8/1/2017