

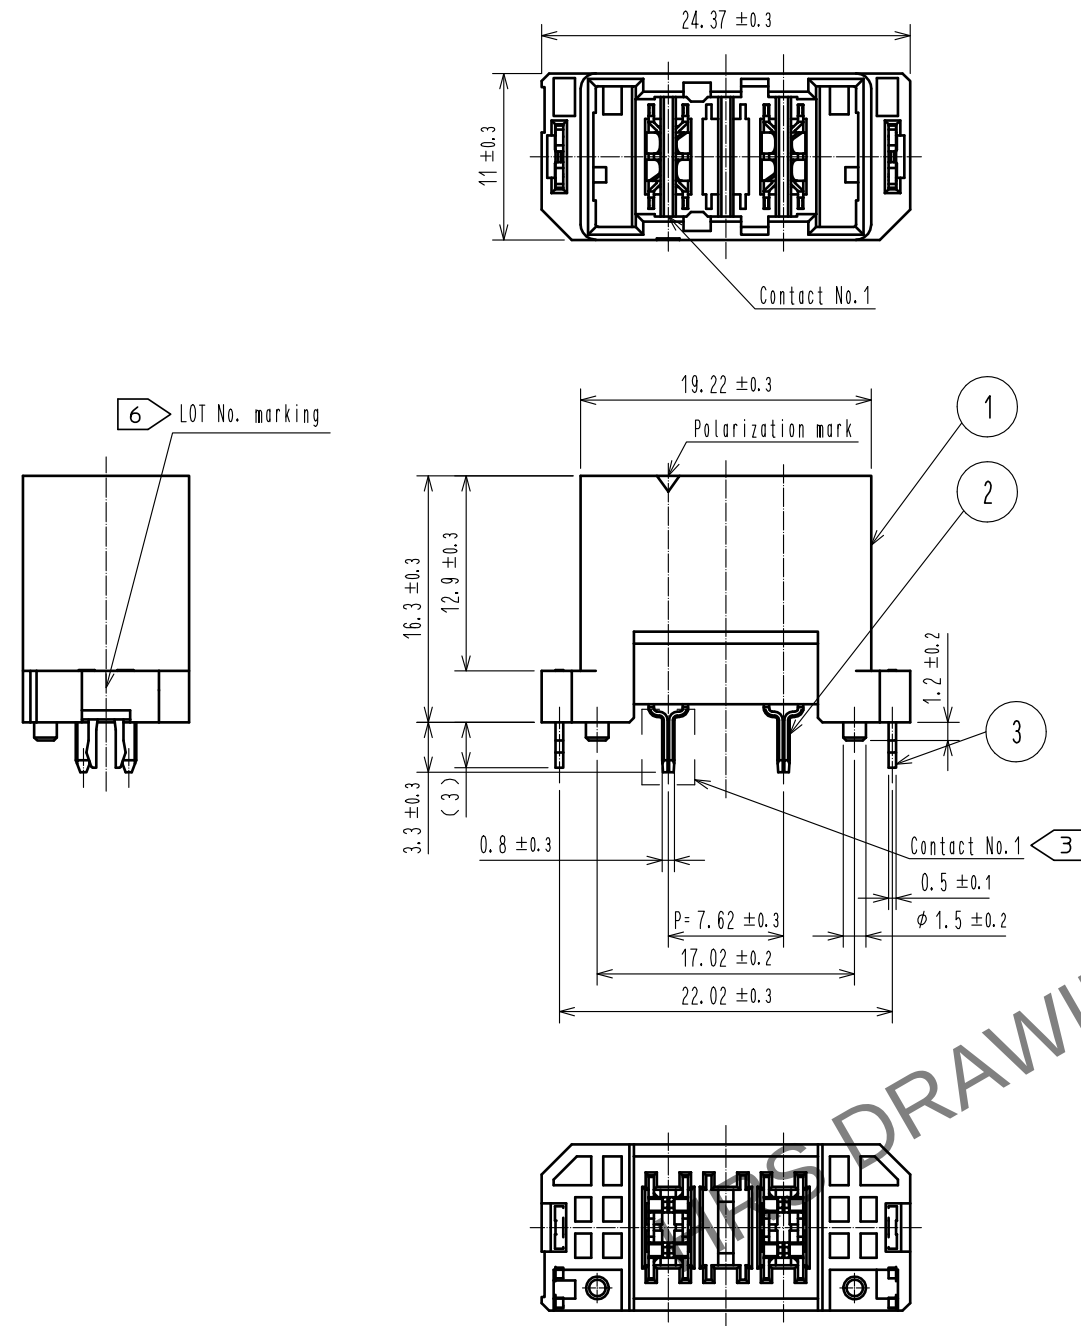


Jul.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

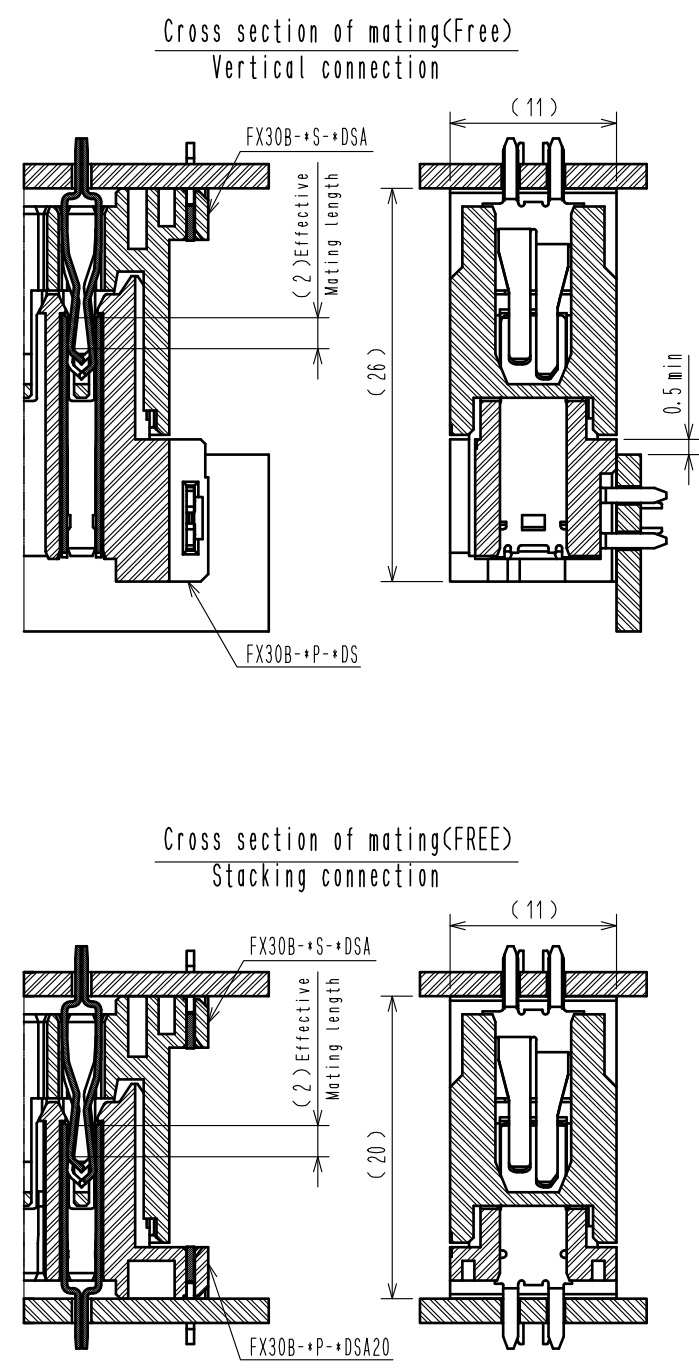


- Note
- 1 This product is packaged in tray. (42pcs/tray)
 - 2 Blemish and hit mark can be occurred through out the manufacturing process which doesn't affect quality level. Also, black spot could be observed on the surface of housing.
 - 3 For the contact No., adjacent two pairs of leads placed back-to-back (4 leads in total) Compose one line.
 - 4 Misalignment absorbing range: ±0.3mm max.
 - 5 The dimension in parentheses are for references.
 - 6 Lot No. is indicated at either one of the position as shown.
 - 7 UL (File No. E52653)
C-UL (File No. E52653)
 - 8 TUV (Certificate No. R50275872) authorization article.

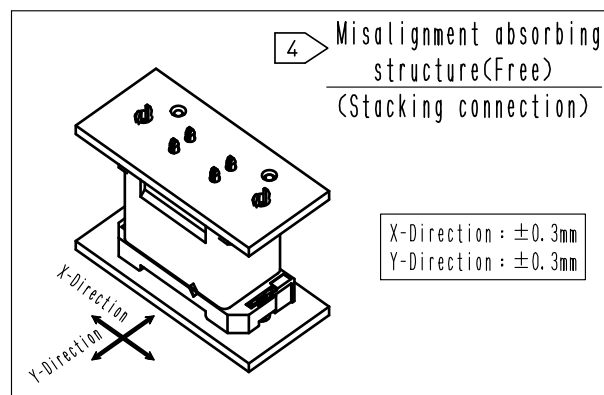

2	Copper alloy	Contact area: Gold-plating 0.1 μm	4	Polystyrene	Tin-plating 3.0 μm
		Lead area: Tin-plating 1.0 μm			
		Under plating: Nickel 1.0 μm			
1	Polyamide	Black UL94V-0	3	Phosphor bronze	Under plating: Nickel 1.0 μm
NO.	MATERIAL	FINISH . REMARKS	NO.	MATERIAL	FINISH . REMARKS
UNITS mm		SCALE 2 : 1	COUNT 1	DESCRIPTION OF REVISIONS DIS-F-00006019	DESIGNED AK. IWAHORI
		APPROVED : HS. OKAWA 20140912		DRAWING NO. EDC3-359165-00	
		CHECKED : KN. SHIBUYA 20140912		PART NO. FX30B-2S-7. 62DSA	
		DESIGNED : DK. AIMOTO 20140912		CODE NO. CL570-3504-2-00	
		DRAWN : DK. AIMOTO 20140912		1/2	

Jul.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

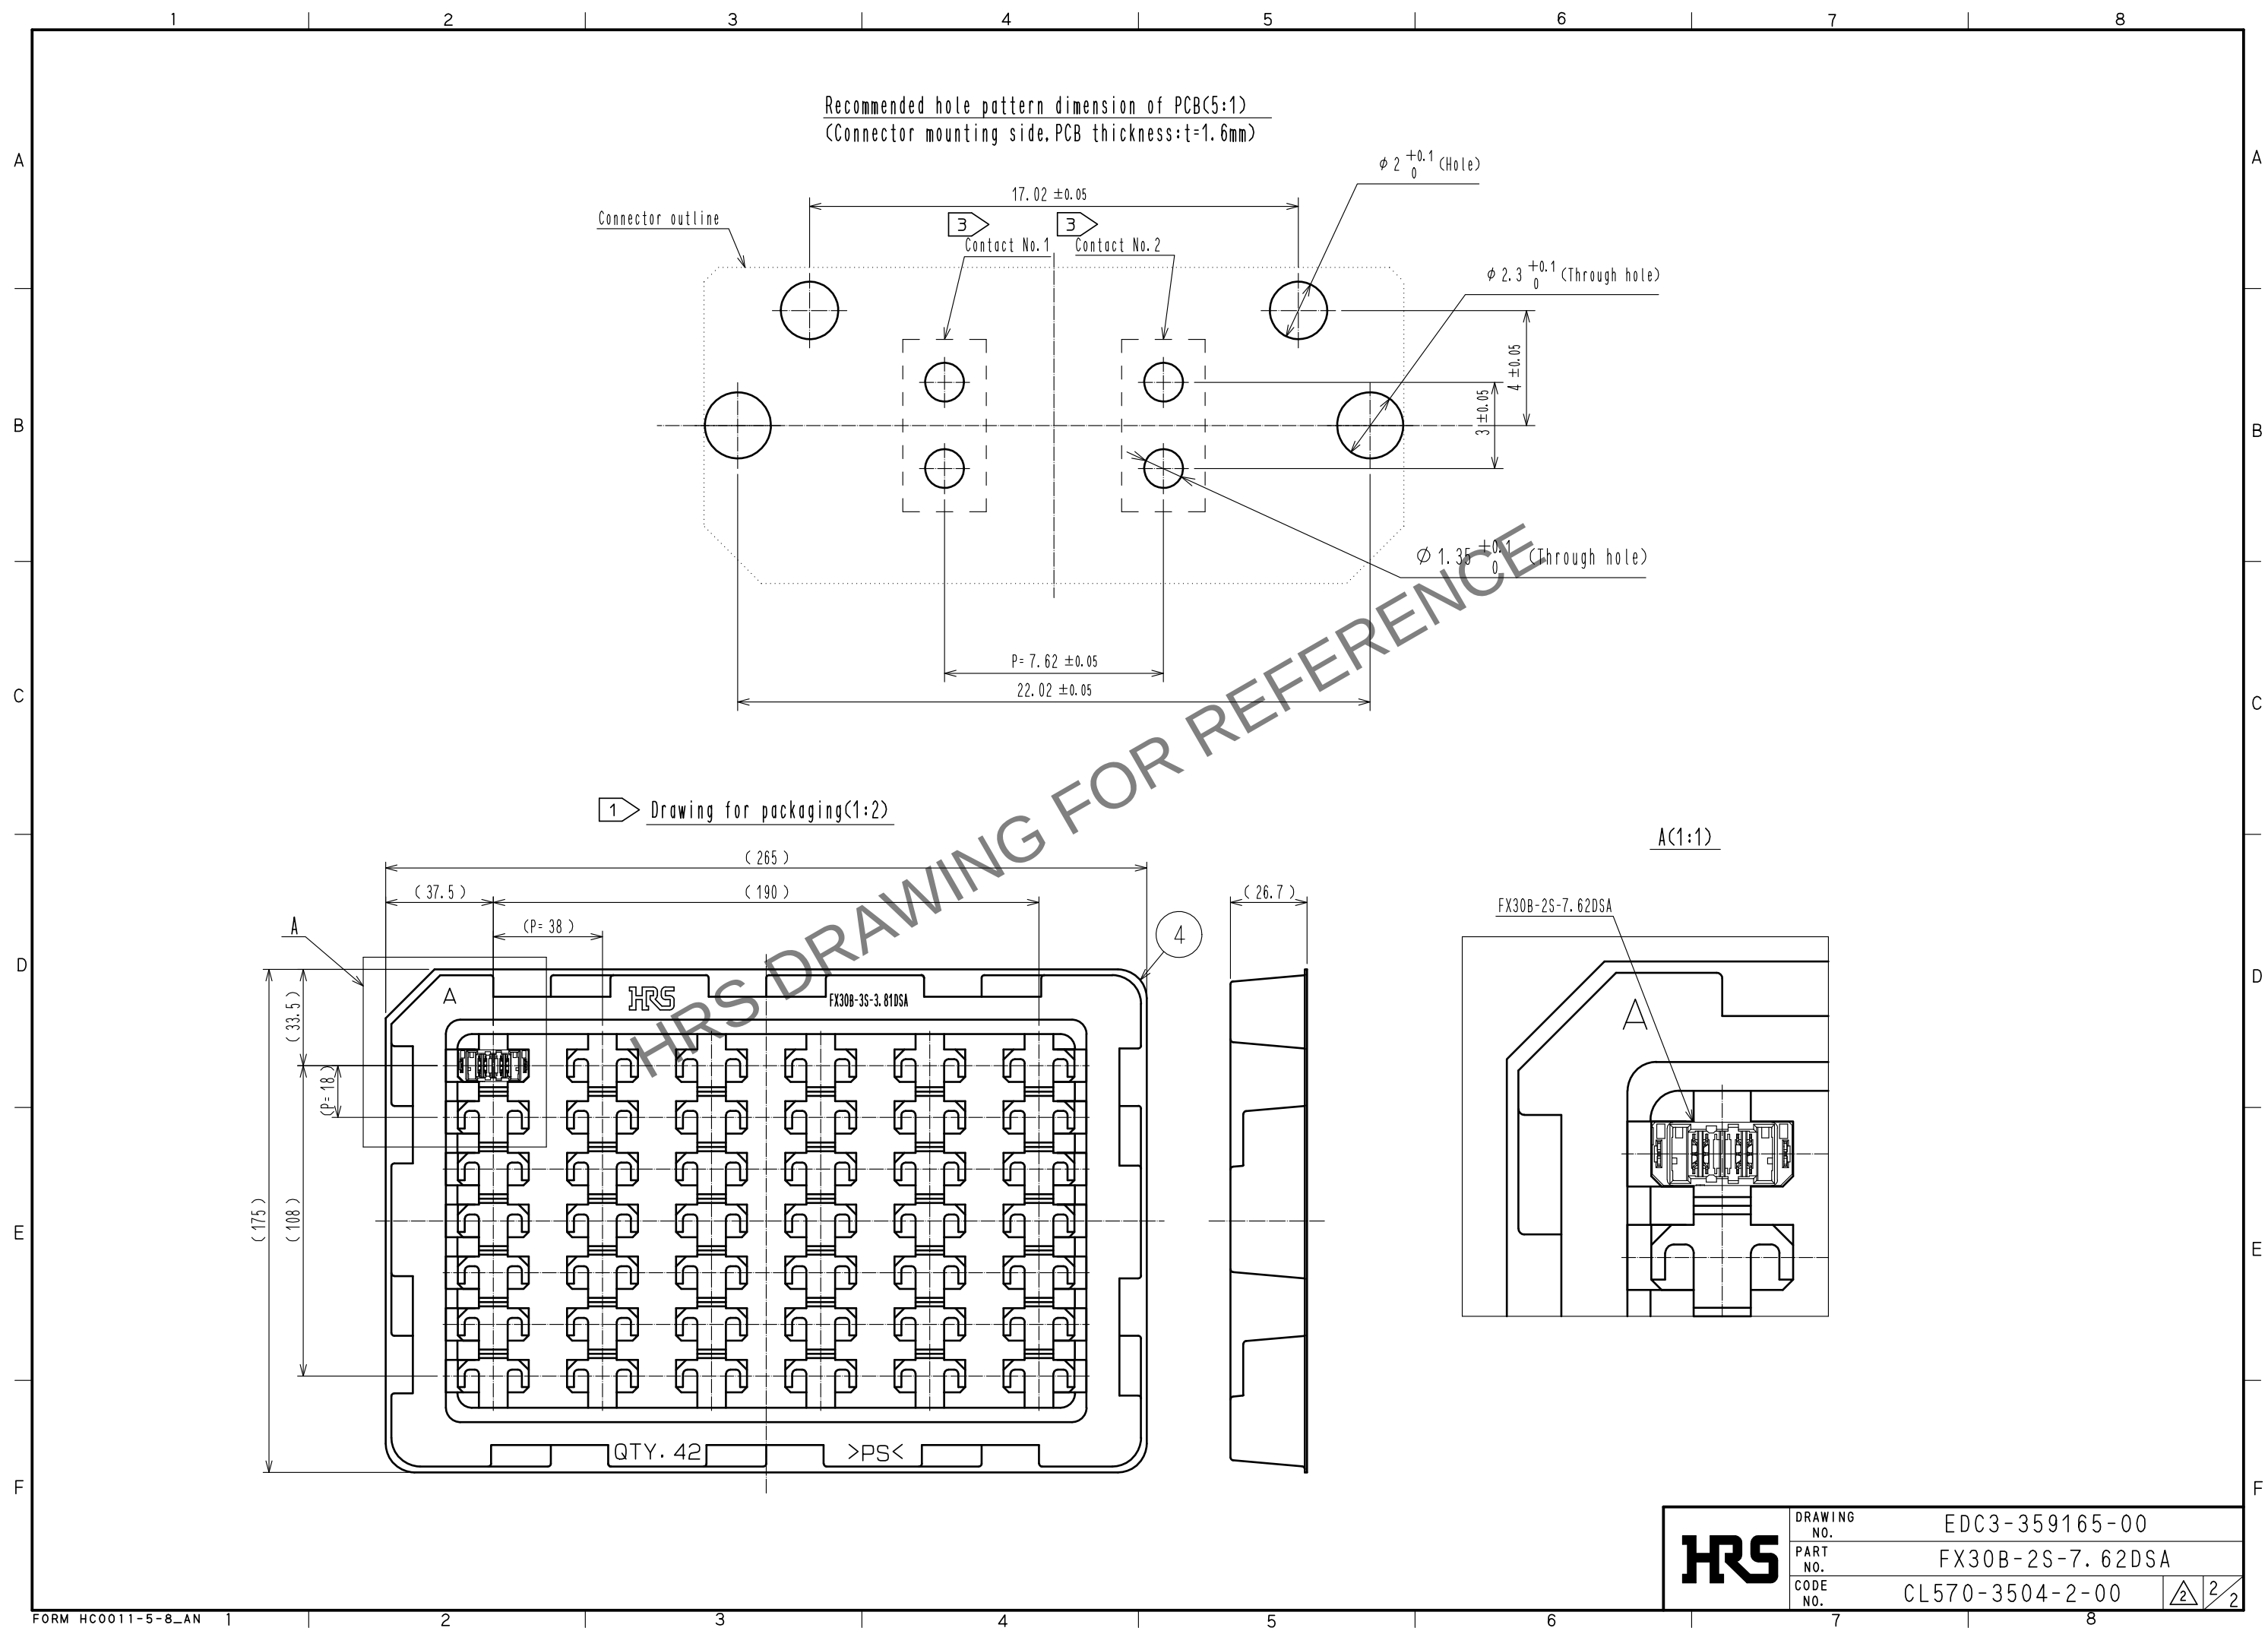

HRS	DRAWING NO.	EDC3-359165-00		
	PART NO.	FX30B-2S-7.62DSA		
	CODE NO.	CL570-3504-2-00	2	2